

LAND CORNER RECORD

Index: E-15	Corner: 1/4 Corner between Sections 3 and 10	State of Indiana - Hoosier National Forest
Section: 10	Township: 7N Range: 1E P.M.: 2nd	County: Monroe
Coordinate:	Lat./N: 1389991.539 Long./E: 3147751.350	Datum: NAD83 IN West Zone, US Survey Feet


CORNER HISTORY: (Chronological history of corner)

1.) Date of Survey:	Surveyor:	Monument:	Recording Information:	Monument Photograph:
9/1984	Ken Anderson L.S. #80040545	A stamped 3" aluminum monument found	USDA Forest Service Bedford, IN	
Reference Objects:	Species:	Diameter:	Bearing:	Distance:
Record evidence of prior survey:	Ken Anderson set this monument in 1983 on an unrecorded survey.			
2.) Date of Survey:	Surveyor:	Monument:	Recording Information:	
5/9/1995	Michael Friley Monroe County Surveyor		Monroe County Surveyor's Office Bk. 95-01, Pg. 36	
Reference Objects:	Species:	Diameter:	Bearing:	Distance:
	Maple	12"	N24°30'00"W	2.47'
	Hickory	12"	S76°E	10.54'
	Ash	12"	S04°W	28.01'
Record evidence of prior survey:				

ACCESSORIES: Bearing and distance from monument to witness object.

Reference Objects:	Object or Tree Species:	Diameter:	Bearing:	Distance:
	Sugar Maple*	16"	N27°W	2.81'
	Pignut Hickory*	17"	S73°E	10.94'
	U-Post w/Sign (SURVEY MARKER)	N/A	N90°E	2.00'
* = old blaze at base of tree	North End of a C.M.P.	12"	S03°W	51.35'
Monument Found or Set:	A 3" aluminum monument stamped "T7N R1E S.3 S.10 1/4" found 0.5' above grade.			


MONUMENT SKETCH

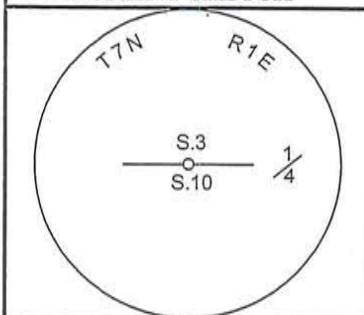

NARRATIVE REFERENCE:

Monument is a 3" aluminum monument stamped "T7N R1E S.3 S.10 1/4" found 0.5' above grade, a carsonite post is located 3.0' west of the monument, located on a steep westerly facing slope, +/- 50' west of a drive, +/- 30' east of a north-south running drainage, surrounded by mature hardwoods, 51' north of a culvert with limestone scattered all around, a rock cairn at the base of the monument.

SECTION DIAGRAM

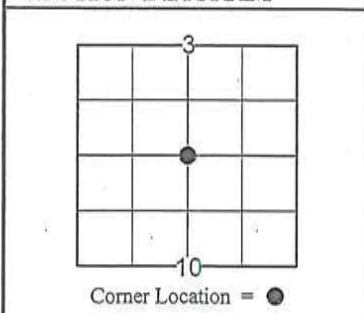

PERPETUATION RECORD:

The record monument was found undisturbed and maintained by remarking two existing bearing trees and establishing two new reference objects. Two existing bearing trees were recovered from Monument Record by Michael Friley, dated 5/9/1995.

Two bearing trees were marked with a bearing tree sign, paint, and mag nail.

Referenced on BRCJ survey recorded as InstNo.2018011507

Accepted by the Monroe County Surveyor Review Board on August 6, 2019.

Section: 10 T7N R1E

Prepared By: BRCJ

(Project#3-0823)

Date: 5/2018

MONUMENT RECORD

Corner I.D. #


0-5

STATE OF INDIANA - COUNTY OF MONROE

Section Ten (10), Township 7 North, Range 1 East

Monument Description & Remarks: Found 3" Aluminum Disc on 2" Aluminum Pipe;
0.6' out of ground. Pipe was solid in ground, cairn of rocks placed around
base. Survey marker sign & post set. Disc marks North 1/4 Corner.

Recovery Tie Drawing

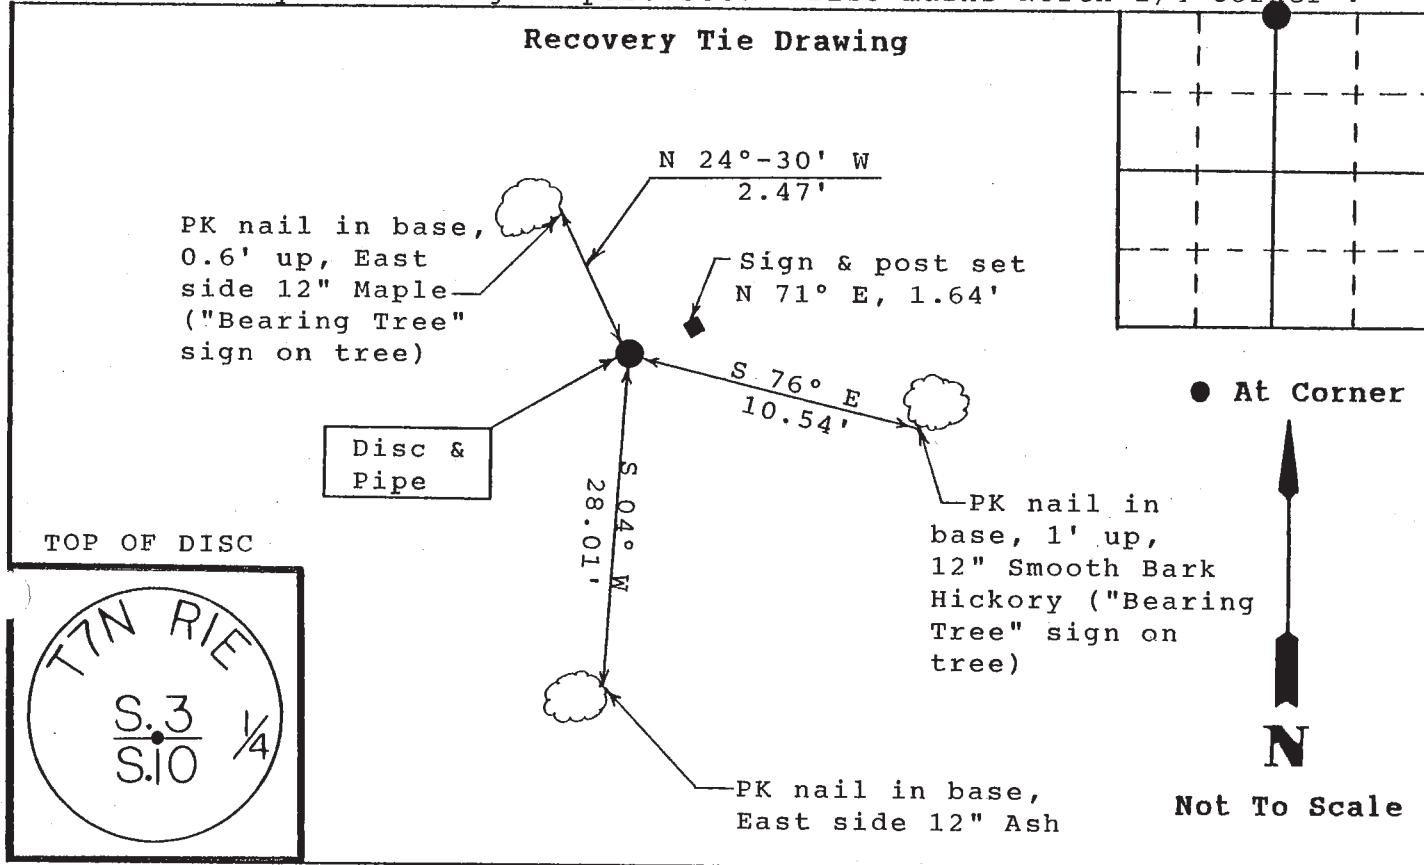

State of Indiana

County of Monroe

I, Michael W. Friley, County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of Section 17-3-64-4 through 17-3-64-8 of the Indiana Code, being Acts of 1965, Chapter 319; and the above data is given under my hand and seal this 9th day of May, 1995 A.D.

Space
Reserved For
Recording
Officer

Indiana Registered Land Surveyor No. _____ or

Office of Monroe County Surveyor
 United States Government Agency

Monroe County Surveyor
 Title

Field Book:

95-01

Page:

36

R9-7150-15 (5/64)

CERTIFIED LAND CORNER RESTORATION

State of Indiana

County of _____

} ss.

I, _____, do hereby certify that on the _____ day of _____, 19____, I found evidence of the _____ corner of _____ Sec's _____ 3 + 10 Township _____ 7 N Range _____ 1 E Second Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:

Description of original monument and accessories and subsequent restorations:

Description of corner evidence found:

Description of monument and accessories I established to perpetuate the original location of this corner:



SET A 3" DIA ALUMINUM CONCRETE FILLED PIPE 36" LONG WITH AN ALUMINUM CAP STAMPED AS SHOWN

ESTABLISHED THE FOLLOWING BEARING TREES:

ELM
6"
S 22 W
17.0

HICKORY
10"
S 78° E
10.6

MAPLE
10"
N 31° W
2.6

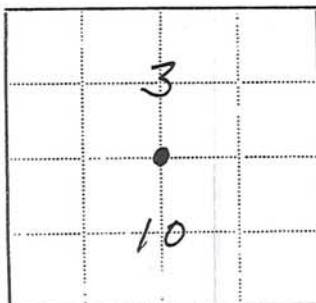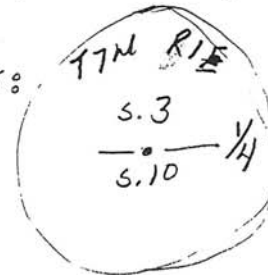

● = Corner monument restored

□ =

Resident witnesses _____

Dated at _____ Indiana, this _____ day of _____, 19____.

Signature _____ Title _____
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Surveyors Registration No. _____

Office of _____ County of _____

I hereby certify that the within instrument was filed in this office for record on the _____ day of _____, 19____, and was filed in Book No. _____ Page No. _____ of County Records.

Signature _____ Title _____

Township _____ 7 N Range _____ 1 E Section _____ 3 + 10 Index No. _____ E-15 Page No. _____

Index No. E-15
(Alphabetical - Numerical)LAND CORNER RECORD
(RECTANGULAR SURVEYS)


R9-7150-4 (Rev. 6/13/67)

GPO 802-127

T. 7 N R. 1 E Mer. N.F. HOOSIER County LAWRENCE State INDIANA
QUARTER Corner common to sections 3 & 10 and

EXISTING SURVEYS

Original Government Survey		Original Evidence Found	
Year surveyed _____		Year of search _____	By _____
Original monument _____ (Wood post, stone, pile of stones, pipe, etc.)		Monument found _____	
Bearing Trees		Original Bearing Trees Found	
Species _____		Species _____	
Diameter _____		Diameter _____	
Bearing _____		Bearing _____	
Distance _____		Distance _____	
Subsequent Corner Restoration		Evidence of Subsequent Corner Restoration Found	
Year surveyed _____	By _____	Year of search <u>1983</u>	By <u>BOB STONE</u>
Where filed or recorded _____		<u>NONE</u>	
Monument _____ (Original, concrete post, iron rod, etc.)			
Bearing Trees, Reference Objects		Bearing Trees, Reference Objects	
Species _____			
Diameter _____			
Bearing _____			
Distance _____			

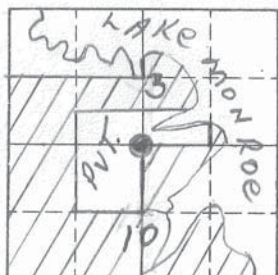

Sketch

○ Corner ■ F.S. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections 3 & 10
 Object RAVINE
 Record distance _____
 Measured distance 60'±W.

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any. A PRIVATE DRIVE (GRAVEL ROAD) WAS BUILT ACROSS THE CORNER OF THE NW 1/4 NE 1/4 SEC 10 ON FOREST SERVICE PROPERTY. THE CORNER IS 60'± NORTH OF THE ROAD ON A NORTH SLOPE AND AT THE EAST SIDE OF A RAVINE

Perpetuation Record

Monument and accessories established. Include brief description of area.
A 3" DIA. ALUMINUM CONCRETE FILLED PIPE 36" LONG WITH AN ALUMINUM CAP WAS SET THE FOLLOWING BEARING TREES WERE ESTABLISHED

ELM	HICKORY	MAPLE
6"	10"	10"
S 22° W	S 78° E	N 31° W
17.0'	10.6'	2.6'

Certified corner restoration certificate prepared: Yes _____ No _____

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. 173 Which is filed at DISTRICT OFFICE9/23/74

At time of search:

1. Did you have the record description?

Yes ☒ No _____

2. How was search area located?

Pacing, chaining, photos, maps, etc. PHOTOS, MAPS

3. Man hours spent in search _____

4. Do you think additional search might recover evidence? Yes _____ No ☒5. Signature Bob Stone

9/28/74



1/4 corner sec's 3 & 10
T7N R1E 6/30/83



1/4 corner sec's 3 & 10
T7N R1E 6/30/83
B.S.

Relation of Evidence to Record Features Along Section Lines
3410
KAVINE
Section line to sections
Object

MAKE
2